


TRM: IMPORTANT GUIDELINES	IN-TRM-H-UK
----------------------------------	--------------------

In this document you will find the most important guidelines regarding measuring with the Temperature Registration Module (TRM). Please refer to the manual for further information.

More detailed information about the measuring principle and interpretation of the results is available on our website.

TOP 10 LIST - IMPORTANT GUIDELINES FOR THE TRM

1. Read the manual (integrated in the software).
2. Remove from the dehydration press before pressing if possible, or lower the pressure for the specific batch.
3. Do not use the TRM with pressures above 20 bar.
4. Do not exceed the maximum temperature/time limits: *max 10 minutes at 90 °C, max 20 minutes at 85 °C, 30 minutes at 80 °C.*
5. Cool the TRM between measurements in tap-water.
6. Protect the TRM during the process by packaging it in a bath-towel or something a-like. This will also give more representative measuring results.

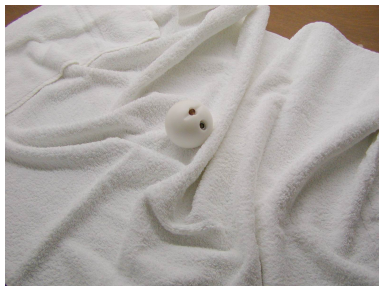

7. Clean the TRM-connector with fresh water and remove the water from the TRM-connector with compressed air after using the TRM and before connecting to the PC.
8. Longer time-intervals between measurements extends battery-life (e.g. 8 seconds instead of 2 seconds).
9. Make sure the calibration has not expired.
10. Remove the cable from the TRM when the TRM is not used.